

Technical Support

Subject

Identifying VR140-VR150 Clutch for Replacement

System or Parts affected

Underhood VR140 / VR150 – Compressor Serial Number starts with P140xxxxxxxxx.

Overview

- As of June 2016, the original design clutch for VR140 / VR150 (VMAC P/N: P200039) is no longer available.
- P/N: P200039 has been superseded by the new P/N: P200050.
- P/N: P200050 is not backwards compatible to the original (old style) compressor front gear case.
- A700234 FRONT GEAR CASE RETROFIT KIT is available to retrofit compressors from the old-style clutch to the new clutch if a replacement clutch is required.

The A700234 FRONT GEAR CASE RETROFIT KIT will only fit aluminum case compressors.

This kit will not fit VMAC's early steel case compressors.

In the event of clutch failure on a steel case compressor, compressor replacement is required.

• Once the A700234 kit has been installed, the new style P200050 clutch will be all that is required.

Identifying the clutch and choosing replacement parts

Obsolete clutch with 4 bolt stator mount (P/N: P200039):

• The P200039 is identifiable by the 4 bolts holding the clutch stator to mounting points on the front gear case cover of the compressor. See *Figure 1*.

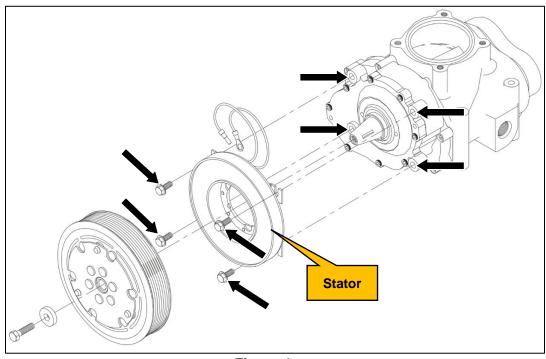


Figure 1

If a replacement clutch is required for a VR140 or VR150 with the old-style clutch, order kit number A700234, which contains the new-style P200050 clutch and an updated front gear case cover assembly.

Document	Version	Department	Revision Details	Revised by	Tech	Engineering	Implemented
EXT-VR-018	С	Tech	Format update, added Note	BDJ	MSP	N/A	19 July 2018

Knowledge Base: www.kb.vmacair.com

Email: tech@vmacair.com Web: www.vmacair.com

Technical Support: 1(888)241-2289

Toll Free:1(800)738-8622 Fax: 1(877)740-3201



Technical Support

Subject Identifying VR140-VR150 Clutch for Replacement

New-Style P200050 clutch with 3 bolt stator mount:

• The new design P200050 clutch is fastened to the compressor gear case using 3 bolts inside the clutch stator. These bolts are not visible when the clutch is assembled. See Figure 2.

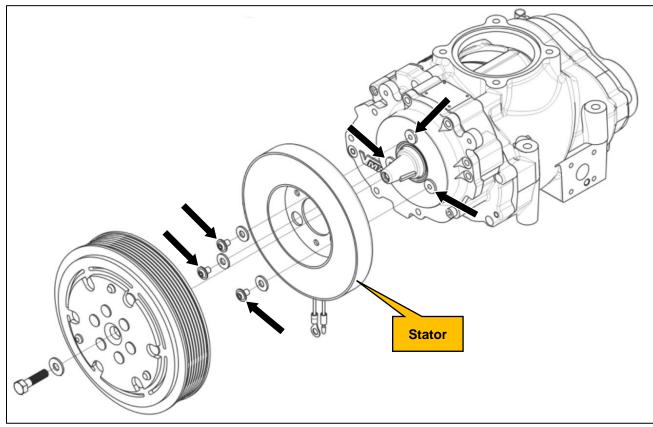


Figure 2

Document	Version	Department	Revision Details	Revised by	Tech	Engineering	Implemented
EXT-VR-018	С	Tech	Format update, added Note	BDJ	MSP	N/A	19 July 2018

Knowledge Base: www.kb.vmacair.com

Email: tech@vmacair.com Web: www.vmacair.com

Technical Support: 1(888)241-2289

Toll Free:1(800)738-8622 Fax: 1(877)740-3201