

Airworthiness Directive

▼ Federal Register Information

This information is not available.

▼ Header Information

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

AD 47-43-01

Airworthiness Directives; CESSNA Model 120 and 140 Airplanes
PDF Copy (If Available):

▼ Preamble Information

AGENCY: Federal Aviation Administration, DOT

▼ Regulatory Information

47-43-01 CESSNA: (Was Mandatory Note 12 of AD-768-5.) Applies to 120 and 140 Aircraft Serial Numbers Up to and Including 11842.

Compliance required prior to January 1, 1948.

Reroute the lower end of the primer line located on the left side of the firewall and rotate the strainer fitting so that it points downward and to the left at an angle of 60 degrees to the horizontal. Slip approximately 6 inches of vinylite tubing over the upper and lower

ends of this primer line and install a shield around this line between the two pieces of vinylite tubing. This will preclude the possibility of fuel coming in contact with the left exhaust manifold in the event of a failure in this primer line.

(Cessna Service Letter No. 34, dated March 24, 1947, covers this same subject.)

▼ **Footer Information**

▼ **Comments**

FAA.gov Home | Privacy Policy | Web Policies & Notices | Contact Us | Help

Readers & Viewers: [PDF Reader](#) | [MS Word Viewer](#) | [MS PowerPoint Viewer](#) | [MS Excel Viewer](#) | [WinZip](#)