

## Airworthiness Directive

### ▼ Federal Register Information

This information is not available.

### ▼ Header Information

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

**AD 47-42-20**

Airworthiness Directives; ERCO Model 415-C, -CD and -D Aircraft  
**PDF Copy (If Available):**

### ▼ Preamble Information

AGENCY: Federal Aviation Administration, DOT

### ▼ Regulatory Information

**47-42-20 ERCO:** (Was Mandatory Note 17 of AD-718-7.) Applies Only to 415-C, -CD and -D Aircraft Serial Numbers 1033 to 1327, Inclusive.

Compliance required not later than next 100-hour inspection.

One of the above airplanes may contain a control column shaft, P/N 415-52129, which is defective at its lower bearing fitting.

In order to ascertain whether the fitting is defective withdraw the shaft from the control column so the surface of lower control shaft fitting, P/N 415-52126, which bears on the lower bakelite bushing, can be examined. If a steel sleeve is found brazed to this lower shaft fitting's bearing surface, the shaft should be replaced and the defective shaft

returned to the manufacturer.  
(Ercoupe Service Policy Letter No. B-10, covering the subject will be issued to each Ercoupe distributor.)

▼ **Footer Information**

▼ **Comments**

**FAA.gov Home | Privacy Policy | Web Policies & Notices | Contact Us | Help**

**Readers & Viewers:** [PDF Reader](#) | [MS Word Viewer](#) | [MS PowerPoint Viewer](#) | [MS Excel Viewer](#) | [WinZip](#)