

Airworthiness Directive

▼ Federal Register Information

This information is not available.

▼ Header Information

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

AD 46-23-02

Airworthiness Directives; ERCO Model 415-C, -CD and -D Aircraft
PDF Copy (If Available):

▼ Preamble Information

▼ Regulatory Information

46-23-02 ERCO: (Was Mandatory Note 5 of AD-718-6.) Applies Only to 415-C, -CD and -D Aircraft Serial Numbers 113 to 263, Inclusive.

The flexible hose in the engine breather line should be inspected immediately. If the inner liner of this hose is an amber color, it is susceptible to contraction and possible clogging. Hose which shows evidence of clogging should be replaced at once by hose supplied by Erco or by equivalent hose such as AN 884 or AN 878. If hose has an amber lining but is still in satisfactory condition, it may be continued in service for a maximum of 25 hours, whereupon it must be replaced by satisfactory hose as described above.

(Ercos Service Department Memorandum No. 11 dated February 1, 1946, covers this same subject.)

▼ **Footer Information**

▼ **Comments**

FAA.gov Home | Privacy Policy | Web Policies & Notices | Contact Us | Help

Readers & Viewers: [PDF Reader](#) | [MS Word Viewer](#) | [MS PowerPoint Viewer](#) | [MS Excel Viewer](#) | [WinZip](#)