

Airworthiness Directive

▼ Federal Register Information

This information is not available.

▼ Header Information

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

AD 61-03-05

Airworthiness Directives; LUSCOMBE Model 8 Series Aircraft
PDF Copy (If Available):

▼ Preamble Information

AGENCY: Federal Aviation Administration, DOT

DATES; Effective March 9, 1961.

▼ Regulatory Information

61-03-05 LUSCOMBE: Amdt. 248 Part 507 Federal Register February 7, 1961. Applies to All Model 8 Series Aircraft Incorporating Wing Fuel Tanks.

Compliance required as indicated.

Within 50 hours' time in service after the effective date of this directive, remove the fairing at the wing root of each wing and inspect the wing root area for interference between the forward fuel line and the aileron cable and/or aileron pulley. Remove the

trim panel over the forward door post and inspect the forward door post area for interference between the forward fuel line and the aileron cable and/or pulley. If any interference is found, bend fuel line sufficiently to provide the necessary clearance. Replace any worn fuel lines being careful to provide clearance when installing the replacement fuel line.

This directive effective March 9, 1961.

▼ **Footer Information**

▼ **Comments**

FAA.gov Home | Privacy Policy | Web Policies & Notices | Contact Us | Help

Readers & Viewers: [PDF Reader](#) | [MS Word Viewer](#) | [MS PowerPoint Viewer](#) | [MS Excel Viewer](#) | [WinZip](#)