

## Airworthiness Directive

### ▶ Federal Register Information

#### ▼ Header Information

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

**AD 51-21-02**

Airworthiness Directives; Piper All Model PA-12 Airplanes  
**PDF Copy (If Available):**

#### ▼ Preamble Information

AGENCY: Federal Aviation Administration, DOT

#### ▼ Regulatory Information

**51-21-02 PIPER:** Applies to All Model PA-12 Airplanes.

Compliance required not later than October 15, 1951, and each 100 hours of operation thereafter unless reinforcements are installed.

Carefully inspect aileron hinge brackets to false spar attachment fittings, P/N N10931, (3 per wing), for cracks at the bend between the channel and flat portions of the fittings. If cracked fittings are found, add reinforcement bracket P/N 12047. With reinforcement brackets P/N 12047 installed, special inspections may be discontinued.

(Piper Service Bulletin No. 107, dated September 24, 1948, covers this same subject.)

▼ **Footer Information**

▼ **Comments**

**FAA.gov Home | Privacy Policy | Web Policies & Notices | Contact Us | Help**

**Readers & Viewers:** [PDF Reader](#) | [MS Word Viewer](#) | [MS PowerPoint Viewer](#) | [MS Excel Viewer](#) | [WinZip](#)