

Airworthiness Directive

▼ Federal Register Information

This information is not available.

▼ Header Information

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

AD 50-23-01

Airworthiness Directives; Piper Models PA-17 and PA-15 Aircraft
PDF Copy (If Available):

▼ Preamble Information

AGENCY: Federal Aviation Administration, DOT

▼ Regulatory Information

50-23-01 PIPER: Applies to All Models PA-17 Aircraft and PA-15 Aircraft Equipped With PA-17 Type Landing Gear Shock Struts.

Compliance required by July 15, 1950.

Inspect landing gear shock strut end fittings, P/N 11806 (four per airplane) for cracks or other defects in the small bend radii. Replace fittings found to be defective. Excessive tightening of the attachment bolts may induce failure by restricting rotation of the fitting

on the bolt, therefore, the end fittings should be installed free to rotate.

(Piper Service Letter No. 129, dated October 28, 1949, covers the same subject.)

▼ **Footer Information**

▼ **Comments**

FAA.gov Home | Privacy Policy | Web Policies & Notices | Contact Us | Help

Readers & Viewers: [PDF Reader](#) | [MS Word Viewer](#) | [MS PowerPoint Viewer](#) | [MS Excel Viewer](#) | [WinZip](#)