

## Airworthiness Directive

### ▶ Federal Register Information

#### ▼ Header Information

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

AD 62-02-06

Airworthiness Directives; Piper Model PA-25 Aircraft  
**PDF Copy (If Available):**

#### ▼ Preamble Information

AGENCY: Federal Aviation Administration, DOT

DATES: Effective January 18, 1962.

#### ▼ Regulatory Information

**62-02-06 PIPER:** Amdt. 387 Part 507 Federal Register January 18, 1962. Applies to Model PA-25 Aircraft, Serial Numbers 25-1 to 25-619 Inclusive, 25-622, 25-623, 25-625, and 25-626.

Compliance required as indicated.

As a result of inspections performed on the aluminum front spar wing-to-fuselage attachment fittings, Piper P/N's 61111-00 and 61111-01, it has been determined that the following action is necessary. Within the next 25 hours' time in service after the effective date of this AD, but not later than February 15, 1962, unless already accomplished, replace the aluminum front spar wing-to-fuselage attachment fittings, Piper P/N's

61111-00 and 61111-01, with steel forgings, Piper P/N's 60113-00 and 60113-01, or equivalent parts approved by the FAA Eastern Region, Engineering and Manufacturing Branch. The steel forgings have 1/8 inch raised digits "60112" or "60112-1" on the parts.

The replacement shall be accomplished in accordance with Piper Service Bulletin No. 206, dated August 24, 1961, or FAA approved equivalent.

(Piper Service Bulletin No. 206, dated August 24, 1961, pertains to this subject.)

This supersedes AD 61-13-02.

This directive effective January 18, 1962.

#### ▼ Footer Information

#### ▼ Comments

**[FAA.gov Home](#) | [Privacy Policy](#) | [Web Policies & Notices](#) | [Contact Us](#) | [Help](#)**

**Readers & Viewers:** [PDF Reader](#) | [MS Word Viewer](#) | [MS PowerPoint Viewer](#) | [MS Excel Viewer](#) | [WinZip](#)