





SUBJECT: Battery box drain tube length

- 1. This bulletin affects Ercoupe airplanes serial numbers 123 to 423 inclusive. It is advisable that the matter be checked and corrected if necessary at the next regular check period.
- 2. The battery box drain tube on the affected airplanes may in some cases be insufficiently long to protrude  $\frac{1}{2}$  inch below the belly skin of the airplane. Where the protrusion is less than  $\frac{1}{2}$  inch,
- $\alpha$  piece of rubber tubing should be slipped over the present tube and secured in place.
- 3. An inspection of the aluminum plating adjacent to the battery drain tube opening should be made looking for corrosion. Should corrosion exist, the area should be thoroughly flushed with a soda solution and thoroughly rinsed with clear fresh water.