

LUSCOMBE AIRPLANE CORPORATION

DALLAS 1, TEXAS

September 25, 1947

SERVICE BULLETIN NUMBER 2-47

SUBJECT: Propeller Spinner Installation.


REFERENCE: Serial Number 5136 and below.

An improved propeller spinner attachment for all Model 8 Series airplanes affected, has been designed with changes to be accomplished per instructions described below and illustrated in accompanying sketch, at your earliest convenience.

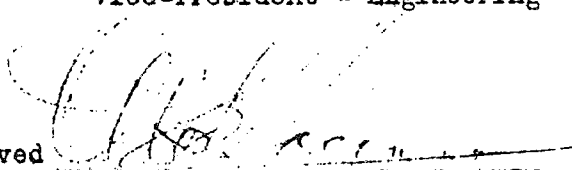
1. Remove propeller spinner attached with two (2) Parker-Kalon Screws.
2. Remove tabs riveted to spinner (Plug rivet holes optional).
3. Plug screw holes in propeller. (Optional).
4. Drill #10 (1935) hole in tip of spinner.
5. Form 1/2 inch flat surface on nose (tip) of spinner.
6. Remove two propeller attach bolts as shown in sketch.
7. Install 281220 Bracket as shown in sketch.
(Omit washers on 2 bolts when bracket is installed.)
8. Re-safety bolts.
9. Install reworked propeller spinner as shown.

A kit containing the following parts necessary for this installation may be obtained upon request directed to the attention of the Service Department.

1. 281220 Bracket
2. AN 526-1032-24 Screw.

Approved 

E. W. Norris
Vice-President - Engineering

Approved 

O. W. Hoernig
Assistant to the President -
Sales and Service

LUSCOMBE AIRPLANE CORPORATION

SERVICE BULLETIN 2-47

Spinner modification to be accomplished in accordance with sketch below.

