

SERVICE BULLETIN NO. 1

SILVAIRE AIRCRAFT COMPANY  
Fort Collins, Colorado

August 11, 1959

For the purposes of Flight Safety enhancement and adopting the more desirable CAR Part 3.345 provision regarding clevis pins in the flight control system, the following change was effected in the aircraft manufacturer's facility and is a highly recommended change on all Model 8 Series Silvaire (Luscombe) Aircraft in your possession.

If you have sold your aircraft please forward this bulletin to the new owner.

CHANGE TO

1. Attach No. 18526 Push-Pull Rod Elevator to the No. 285064 Elevator Bellcrank with:

AN 24-13 Clevis Bolt	1 Req.
AN 960-416L Washer	1 Req.
AN 320-4 Nut	1 Req.
AN 380-2-3 Cotter Pin	1 Req.

2. Attach No. AN 161-34 RL Fork-Elevator Control Cables to No. 285064 Elevator Bellcrank with:

AN 24-13 Clevis Bolt	2 Req.
AN 960-416L Washer	2 Req.
AN320-4 Nut	2 Req.
AN 380-2-3 Cotter Pin	2 Req.

SERVICE BULLETIN NO. I  
SILVAIRE AIRCRAFT COMPANY  
Fort Collins, Colorado

