

SERVICE BULLETIN #2

We have received reports of failure of the rod end fitting on the lower end of the landing gear jack strut on the two piece landing gear used on the Model 8 Luscombes prior to serial number 5725. For the purpose of correcting this condition we recommend the following repair:

1. Remove the jack strut.
2. Drill out present hole in lower end of jack strut with "W" (.386) drill.
3. Tap 7/16 - 20 NF3
4. Install S-9A rod end fitting (7/16" DIA) in place of the original S-9 (5/16" DIA) fitting, using AN 315-7R lock nut.
5. Re-install jack strut.