

IMMEDIATE ACTION

SERVICE



BULLETIN

August 22, 1947

Number 101

SUBJECT: Ignition Wire Shielding

TO: Owners of Piper PA-12 Airplanes Serial No.
12-1 to 12-2781.

A majority of the above serial number airplanes have the external type attachment for the ground wire on the magneto. (See Sketch on opposite side.)

There is a possibility that the shielding on the magneto ground wire on these airplanes may come in contact with the terminal at the magneto attachment. This will cause grounding of the magneto and result in engine failure.

To prevent the occurrence of this difficulty, it is recommended that the shielding be withdrawn from the plastic sleeve, and securely taped to the wire as shown on the sketch.

Appropriate notes should be made in the aircraft log book when this change has been completed.

SERVICE DEPARTMENT
PIPER AIRCRAFT CORPORATION

PIPER AIRCRAFT CORPORATION, LOCK HAVEN, PA., U. S. A.

