


IMMEDIATE ACTION

SERVICE

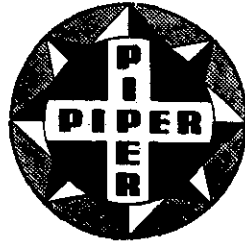

BULLETIN

Service Bulletin No. 118

September 21, 1951


TO: All Distributors, Dealers, and Owners

SUBJECT: Battery Box Lid Modification

MODELS AFFECTED: PA-16 Airplanes with Serial Numbers 16-1 and up; PA-20 Airplanes with Serial Numbers 20-1 thru 20-802 inclusive; and PA-22 Airplanes with Serial Numbers 22-1 thru 22-348 inclusive.

It is necessary that the battery box lids in the above listed airplanes be modified in accordance with the following instructions, to eliminate the possibility of "shorting" the battery terminal wing nuts.

Remove the wood block located between the battery cable openings. Place the fibre insulator, Piper Part Number 90150-8, inside the lid as shown in the following sketch. Replace the wood block using the same screws.

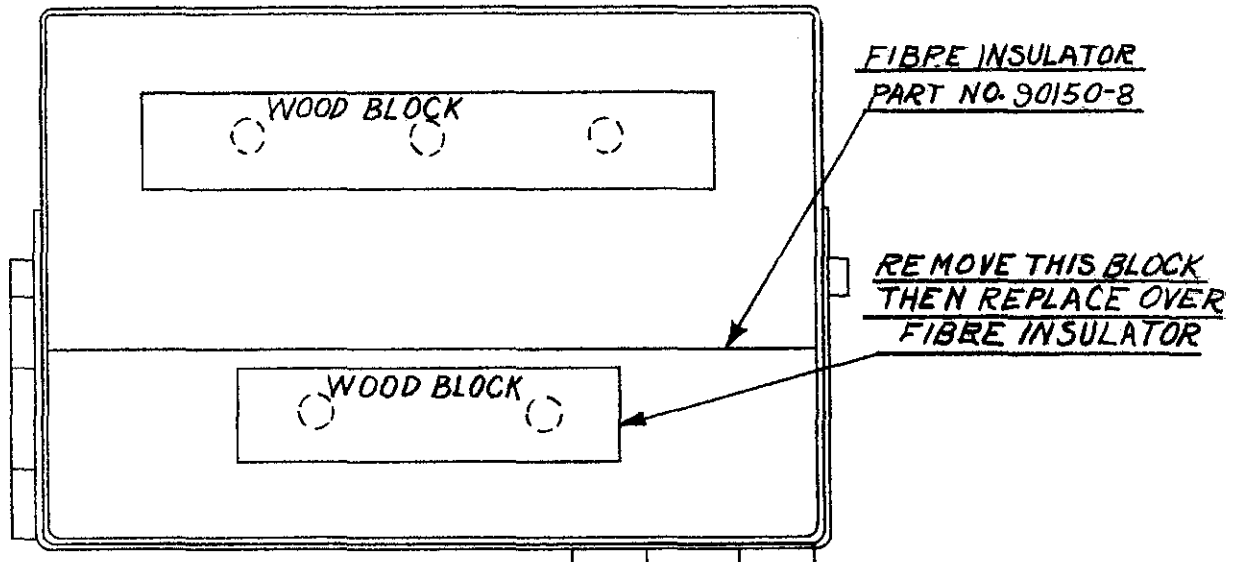

Very truly yours,

PIPER AIRCRAFT CORPORATION

R. Boardman
Rolland Boardman
Service Manager

PIPER AIRCRAFT CORPORATION, LOCK HAVEN, PA., U. S. A.