

IMMEDIATE ACTION

SERVICE



BULLETIN


Service Bulletin No. 124

August 30, 1954

SUBJECT: PA-22 Landing Gear
TO: All Distributors, Dealers, Owners and Operators
MODELS AFFECTED: All Model PA-22 Airplanes

A number of field service reports have been received to the effect that cracks have been appearing in the leading edge of the streamlined tube of the PA-22 landing gears at a point where it joins the inboard end of the axle.

Indications are that this is a fatigue failure and it is requested that all Model PA-22 airplanes listed above be modified by installing a reinforcing strap, part number 14415-00, as per the sketch below.

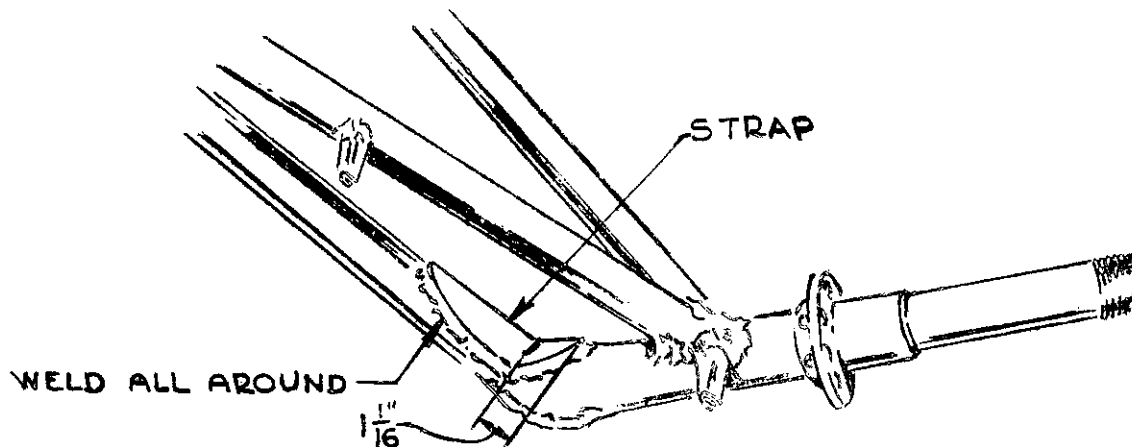

The reinforcement strap can be obtained from the Service Department of the Piper Aircraft Corporation, free of charge.

Very truly yours,

PIPER AIRCRAFT CORPORATION

Rolland Boardman
Service Manager

RB:it

PIPER AIRCRAFT CORPORATION, LOCK HAVEN, PA., U. S. A.