

IMMEDIATE ACTION

**SERVICE**



**BULLETIN**

Service Bulletin No. 143

October 7, 1955

TO: All Distributors, Dealers, Owners and Operators

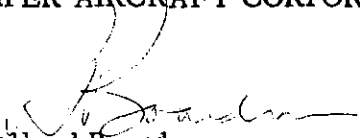
SUBJECT: Magneto Ground Wire Terminal Attachment Nut

MODELS AFFECTED: All

We have received a report to the effect that the terminal attachment nut on the magneto ground wire on one of our airplanes was not safetied. It is therefore requested that the subject terminal nut be inspected, and if it is not safetied, safetying should be accomplished by using brass Grade A .032 diameter safety wire through the safety wing holes provided in the magneto and the terminal attachment nut.

Very truly yours,

PIPER AIRCRAFT CORPORATION

  
Rolland Boardman  
Service Manager

RB:mh

**PIPER AIRCRAFT CORPORATION, LOCK HAVEN, PA., U. S. A.**