


**ERCOUPE  
SERVICE  
BULLETIN**

**No. 9**

# *Ercoupe* **BULLETIN**

**SUBJECT: Muffler tube clamp**

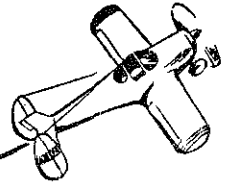

**1.** This memorandum affects Ercoupe serial numbers 513 to 1412 inclusive. The material necessary to affect this change will be shipped direct to the distributors for distribution to dealers and owners.

**2.** The tube clamps AN748-66-74-82 used to secure the muffler to the exhaust stacks, have not been providing satisfactory service in that they permit the muffler to loosen and move around. Sufficient quantities of the replacement item will be delivered to each of our distributors to provide replacements for the affected airplanes.

**3.** The replacement clamp is part number 415-40167. It is distinguishable as a welded-up type with an AN bolt with drilled head using a wing nut. The clamps may be sprung open to allow them to pass over the exhaust pipes when installing. The tubing clamps being removed may be scrapped.

**4.** Distributors and dealers are requested to advise Ercoupe owners immediately following receipt of material and the availability of your service facilities to accomplish the installation of this piece.