


Ercoupe BULLETIN

ERCOUPE
SERVICE
BULLETIN

No. **12**

SUBJECT: Fuel System – Carburetor Elbow

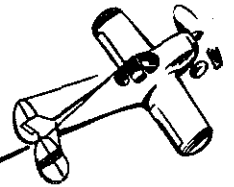

1. This memorandum affects all Ercoupes, serial number 113 to 2134 inclusive with the exception of certain ones which were changed prior to delivery. The exceptions are listed as follows

1987	2097	2105	2111	2119	2127
2006	2098	2106	2113	2121	2128
2013	2099	2107	2114	2122	2129
2033	2102	2109	2115	2123	2130
2059	2103	2110	2117	2125	2131
			2118	2126	2133

2. Several reports have reached us to the effect that the fitting, (AN914-2D) which is located between

the fuel filter and the carburetor, has failed. This fitting is made of Aluminum Alloy. The fitting has been changed to AN914-2, made of Copper Alloy, on all airplanes after No. 2133.

3. It is recommended that the aluminum alloy fitting be replaced with the copper alloy fitting by all owners at their earliest convenience to prevent possible failure.

4. Ercoupe Distributors and Dealers are requested to disseminate this information to all owners and operators immediately. Your cooperation in this matter will be appreciated.

**SUPERCEDED BY SERVICE
BULLETIN NUMBER 24B**