

## IMMEDIATE ACTION

# SERVICE



# BULLETIN

July 28, 1947

Number 98

**SUBJECT:** Battery Insulator

**TO:** Owners of Piper Model PA-12 Airplanes  
Serial Nos. 12-1 to 12-796 inclusive,  
12-815, 12-817, to 12-822 inclusive,  
12-825 to 12-831 inclusive, 12-833,  
12-835 to 12-848 inclusive, 12-863 to  
12-893 inclusive, 12-895 to 12-901  
inclusive.

It has been discovered that there is a possibility of a short circuit occurring between the battery terminal bases and the battery box on the above airplanes.


To eliminate this possibility, it is recommended that a strip of wood be fastened to the upper inside edge of the battery box (on the terminal side), as shown on the sketch on the opposite side of this bulletin.

If the Reading R24L Battery has been replaced with an S24 Battery, and the proper spacer channels, Part No. 10926 and 10927, installed, it will not be necessary to add the wood strip.

An appropriate entry should be made in the aircraft log book upon the completion of this change.

SERVICE DEPARTMENT  
PIPER AIRCRAFT CORPORATION

**PIPER AIRCRAFT CORPORATION, LOCK HAVEN, PA., U. S. A.**

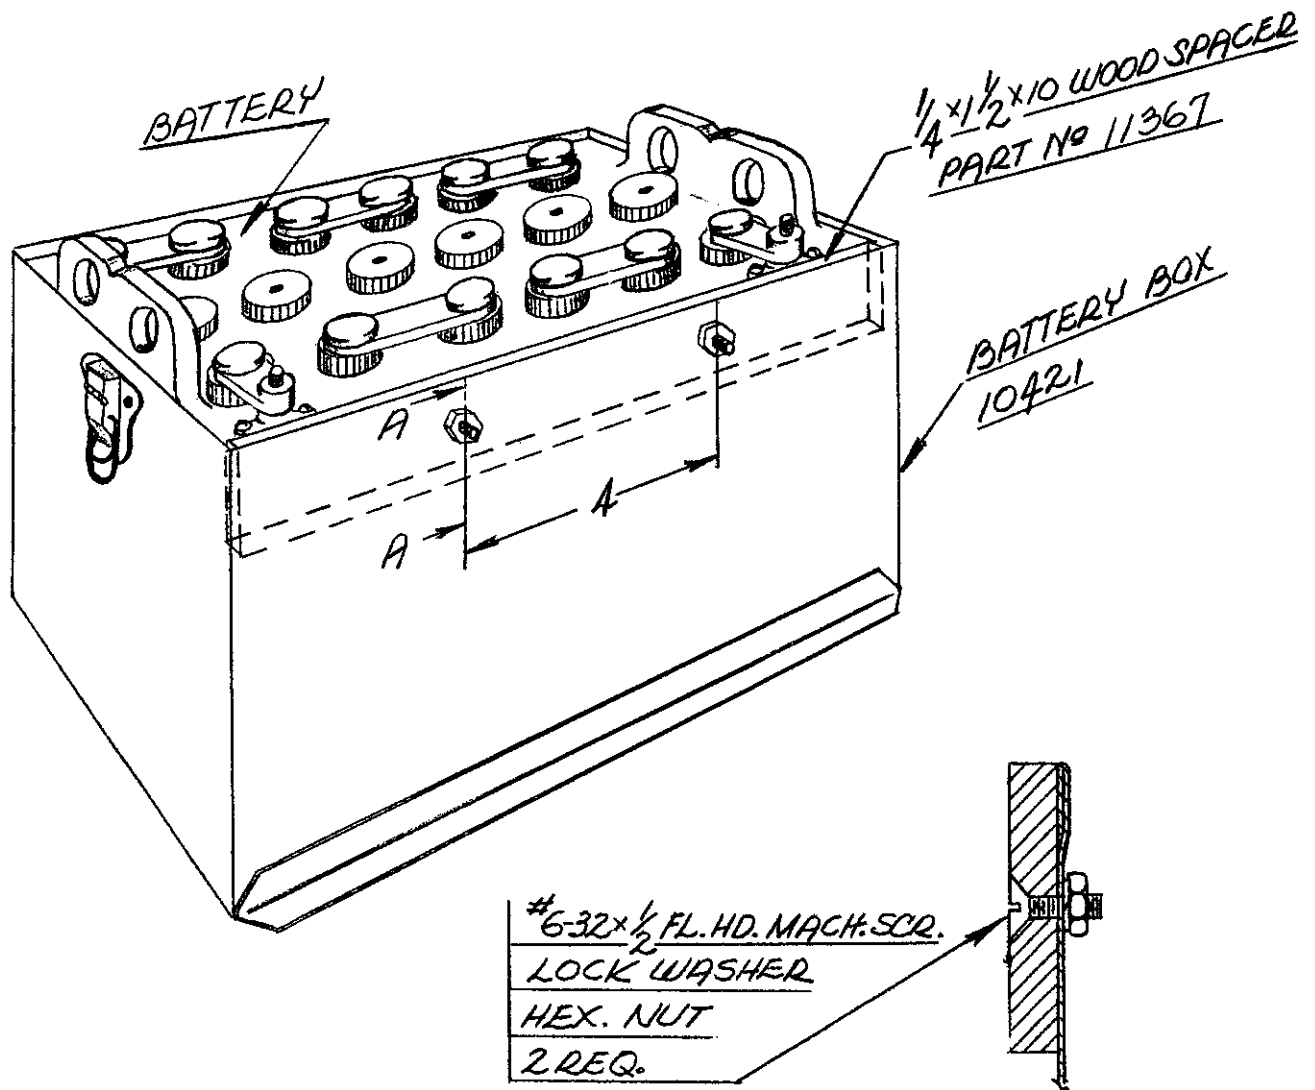

BATTERY SPACER INSTALLATION